DEPARTMENT OF HEALTH AND HUMAN SERVICES FOOD AND DRUG ADMINISTRATION			
DISTRICT ADDRESS AND PHONE NUMBER	DATE(S) OF INSPECTION		
158-15 Liberty Avenue	6/20/2017-6/23/2017		
Jamaica, NY 11433	FEINUMBER		
(718) 340-7000 Ext:5301 Fax: (718) 662-566	3010987875		
NAME AND TITLE OF INDIVIDUAL TO WHOM REPORT ISSUED	<u>'</u>		
Alec Gillies , General Manager			
FIRM NAME	STREET ADDRESS		
Buffalo Pharmacies Inc	6035 Transit Rd		
CITY, STATE, ZIP CODE, COUNTRY	TYPE ESTABLISHMENT INSPECTED		
East Amherst, NY 14051-1803	Producer of Sterile & Non-Sterile Drug		
TO STORMED BEING TO ACCOMPLICATION AND AND A STORMED TO STORMER ACCOMPLICATION OF THE PROPERTY	Product		

This document lists observations made by the FDA representative(s) during the inspection of your facility. They are inspectional observations, and do not represent a final Agency determination regarding your compliance. If you have an objection regarding an observation, or have implemented, or plan to implement, corrective action in response to an observation, you may discuss the objection or action with the FDA representative(s) during the inspection or submit this information to FDA at the address above. If you have any questions, please contact FDA at the phone number and address above.

DURING AN INSPECTION OF YOUR FIRM WE OBSERVED:

OBSERVATION 1

Clothing of personnel engaged in the processing of drug products is not appropriate for the duties they perform.

Specifically, your firm failed to establish a gowning procedure and aseptic processes that reduces the possibility of chemical and microbial contamination of compounded products manufactured in the ISO 5 laminar flow hood.

- (a) On 6/20/17, we observed the compounding technician re-use a gowning jacket between multiple product compound preparations. As per the technician, your firm uses only one gown jacket during the daily routine compounding processes and disposes of it at the end of the day.
- (b) On 6/20/17, we observed the compounding technician donning gloves inside the ISO 5 laminar flow hood, exposing the product contact surface areas to exposed skin.
- (c) On 6/20/17, we observed the compounding technician introducing unfiltered air into a sterile bottle of Tacrolimus vet product through a syringe in order to create positive pressure.

OBSERVATION 2

OBSERVATION 3

Procedures designed to prevent microbiological contamination of drug products purporting to be sterile are not established and followed.

Specifically, you have not performed media fills that closely simulate aseptic production operations incorporating, as appropriate, worst-case activities and conditions that provide a challenge to aseptic operations.

EMPLOYEE(S)SIGNATURE SFE REVERSE Rachael A Moliver Investigator 6/23/2017

SEE REVERSE
OF THIS PAGE
Rachael A Moliver, Investigator
Jose O Hernandez, Investigator

X Rachael A Moliver
Reduct A Moliver
Reduct A Moliver
Reduct A Moliver
Synchry Rachael Moliver

DEPARTMENT OF HEALTH AND HUMAN SERVICES FOOD AND DRUG ADMINISTRATION			
DISTRICT ADDRESS AND PHONE NUMBER 158-15 Liberty Avenue Jamaica, NY 11433	DATE(8) OF INSPECTION 6/20/2017-6/23/2017 FEI NUMBER		
(718) 340-7000 Ext:5301 Fax: (718) 662-5661	3010987875		
NAME AND TITLE OF INDIVIDUAL TO WHOM REPORT ISSUED	-		
Alec Gillies , General Manager			
FIRM NAME	STREETADDRESS		
Buffalo Pharmacies Inc	6035 Transit Rd		
CITY, STATE, ZIP CODE, COUNTRY	TYPE ESTABLISHMENT INSPECTED		
East Amherst, NY 14051-1803	Producer of Sterile & Non-Sterile Drug Product		

Aseptic processing areas are deficient regarding the system for cleaning and disinfecting the room and equipment to produce aseptic conditions.

Specifically,

- (a) Cleaning wipes used in the ISO 5 aseptic processing area are not sterile. Your firm is currently using the non-sterile wipes, (b) (4) for the sanitization of the ISO 5 laminar flow hood surface areas.
- (b) Sporicidal agents are not used in your facility's cleanroom and ISO 5 area. Currently, your firm uses non-sterile, (b) (4)

 for the disinfection of the ISO 5 laminar flow hood surface areas.

OBSERVATION 4

Aseptic processing areas are deficient regarding the system for monitoring environmental conditions.

Specifically,

- (a) You do not conduct viable and non-viable monitoring of the ISO 5 and ISO 7 areas during dynamic processes. You do not possess the necessary equipment to conduct such testing, nor is it performed by an outside contractor. Currently, your firm only performs non-viable monitoring of the ISO 5 and ISO 7 areas during (b) (4) conditions, (b) (4)
- (b) You do not perform smoke studies under dynamic conditions to demonstrate and assure proper air flow patterns in the ISO 5 laminar flow hood area.

OBSERVATION 5

Adequate ventilation is not provided.

Specifically,

(a) Your firm failed to provide adequate positive air pressure and air changes of the ISO 8 anteroom in connection to the hallways; thus, allowing the possibility of environmental contaminants to enter the ISO 8 area, as per the Cleanroom Certification Report from February 16, 2017. This is an ongoing issue, for which your firm doesn't monitor the pressure differentials and the air changes on a routine basis.

	EMPLOYEE(S) SIGNATURE	DATE ISSUED
SEE REVERSE	Rachael A Moliver, Investigator	6/23/2017
OF THIS PAGE	Jose O Hernandez, Investigator X Radhael A Moliver	
	Reduct A Milner Provilente Synchro Rathed Milner 5	**
EODIA EDA 492 (00)093	DEPUGLISHMENT INSPECTIONAL OPERLYATIONS	DAGE 2 OF 2 DAGES